

# Digital TENSION INDICATOR

Model DPM501  
Model DPM502

The DPM501/502 is designed to connect to the TS621 or TS481 Strain Gauge Amplifier, as well as the RFSE Tension Sensor.


It incorporates built-in calibration adjustments to scale the tension values into display units. The 3½ LED display has a user-set decimal point and will display values up to 1999.

## FEATURES

- Selectable “damping function” reduces display fluctuations
- Easy snap-in installation



115 VAC converter (Model DPM501)

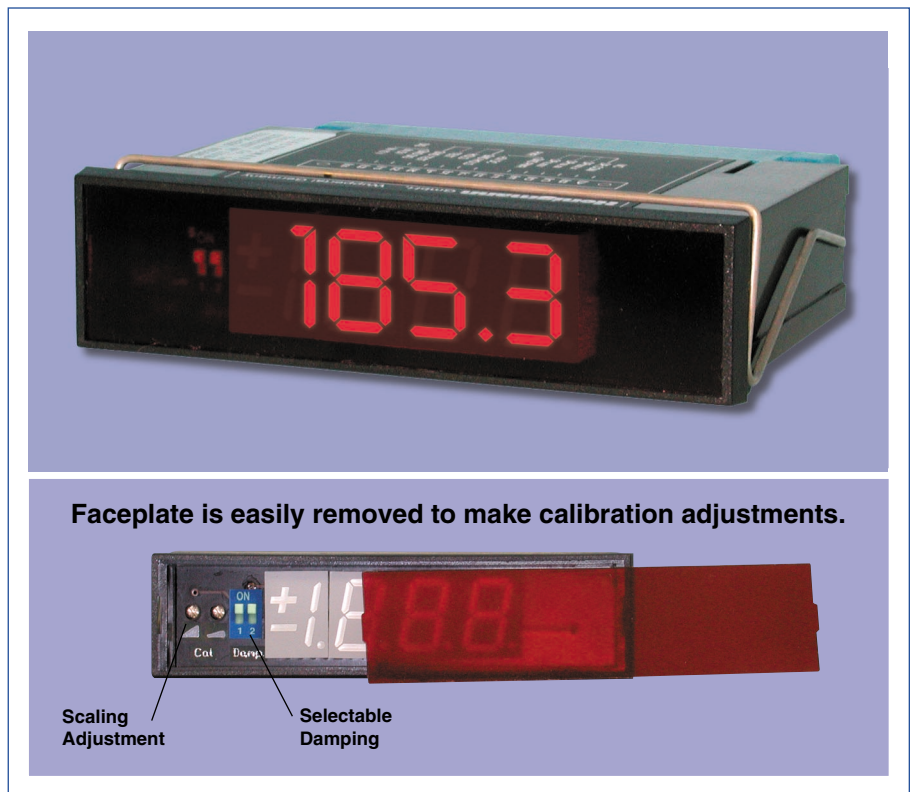

## SPECIFICATIONS

<b>Display</b>	3½-digit LED (1999 max.)
<b>Display Type/Height</b>	LED/14mm
<b>Decimal Point</b>	User-Selected
<b>Damping Rate</b>	0.2 to 4 sec.
<b>Display Update Rate</b>	0.5 sec.
<b>Panel Cutout</b>	92 x 22mm
<b>Weight</b>	3.5 ounces (100 g)
<b>Dimensions</b>	3.7" W x 3" D x 1" H (96 x 77 x 24mm)
<b>Operating Power</b>	5 VDC (provided by supplied converter)
<b>DPM501</b>	115 VAC
<b>DPM502</b>	24 VDC (Supplied with integrated 24 VDC to -5 VDC converter)

Visit us on the World Wide Web at [www.checkline.com](http://www.checkline.com)

**ELECTROMATIC** Equipment Co., Inc., 600 Oakland Ave., Cedarhurst, NY 11516 – USA  
Tel: 800-645-4330 (USA & Canada) ■ Tel: (516) 295-4300 ■ Fax: (516) 295-4399